





GEHSR/L : Grooving and turning holders, for Swiss-type automatics.

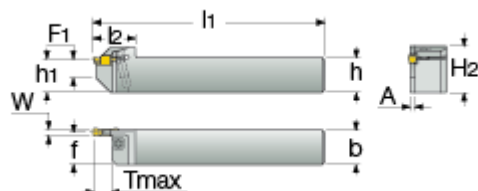

Left-hand shown



Designation	h	W min	W max	Tmax-r	h1	b	l1	f	A	l2	F1	H2
GEHSL 8-1	8.0	1.40	1.90	2.00	8.0	8.0	120.00	7.1	1.00	17.0	7.0	12.0
GEHSR 8-1	8.0	1.40	1.90	2.00	8.0	8.0	120.00	7.1	1.00	17.0	7.0	12.0
GEHSL 8-2	8.0	2.20	3.20	6.80	8.0	8.0	120.00	7.1	1.80	17.0	7.0	12.0
GEHSR 8-2	8.0	2.20	3.20	6.80	8.0	8.0	120.00	7.1	1.80	17.0	7.0	12.0
GEHSL 10-2	10.0	2.20	3.20	6.80	10.0	10.0	120.00	9.1	1.80	17.0	7.0	14.0
GEHSR 10-2	10.0	2.20	3.20	6.80	10.0	10.0	120.00	9.1	1.80	17.0	7.0	14.0
GEHSL 12-2	12.0	2.20	3.20	6.80	12.0	12.0	120.00	11.1	1.80	17.0	8.0	16.0
GEHSR 12-2	12.0	2.20	3.20	6.80	12.0	12.0	120.00	11.1	1.80	17.0	8.0	16.0
GEHSL 16-2	16.0	2.20	3.20	6.80	16.0	16.0	120.00	15.1	1.80	20.0	8.0	20.0
GEHSR 16-2	16.0	2.20	3.20	6.80	16.0	16.0	120.00	15.1	1.80	20.0	8.0	20.0
GEHSL 20-2	20.0	2.20	3.20	6.80	20.0	20.0	120.00	19.1	1.80	20.0	-	24.0
GEHSR 20-2	20.0	2.20	3.20	6.80	20.0	20.0	120.00	19.1	1.80	20.0	-	24.0
GEHSL 25-2	25.0	2.20	3.20	6.80	25.0	25.0	120.00	24.1	1.80	20.0	-	29.0
GEHSR 25-2	25.0	2.20	3.20	6.80	25.0	25.0	120.00	24.1	1.80	20.0	-	29.0